

PARTS BULLETIN



Continental Girbau • Girbau Industrial • Sports Laundry Systems
Onepress • Poseidon Textile Care • LG Commercial • Econo

Reference		Date
PB-157	EH060 Inverter Change	11/7/2022
Product	EH060 Inverter Part Number 13956024	


Summary

Due to supply chain issues the 200-240 VAC EH060's inverters (part number 613893) has been temporarily substituted to a new inverter (part number 13956024). This change in production machines started at serial number 2404222. The inverters for the most part look identical. To identify the inverter, look at the manufacturer's model number (TYPE) (see picture below).

There has also been a software change to allow the new inverter to properly communicate with the microprocessor. The new software (v 46 and v91) are backwards compatible. The only difference in software is based on the control types.

- The Inteli control machines will use version 46.
- The Logi and Vended control will use version 91.

Once the supply chain catches back up inverter 613893 will be exclusively used for both production and service parts.

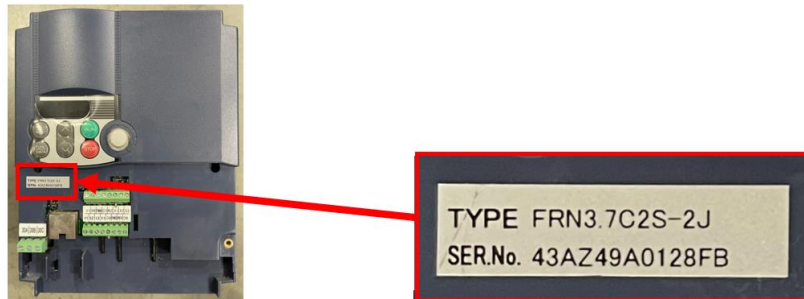

Control Type	Voltage Range	Inverter Part Number	Fuji Part Number	Software Required
Inteli	200-240 VAC	613893	FRN 0020 C2S-2J	Any applicable
		613893	FRN 3.7 C2S-2J	Any applicable
		13956024	FRN 0020 C2S-2A	v46 and newer
Logi/ Vended	200-240 VAC	613893	FRN 0020 C2S-2J	Any applicable
		613893	FRN 3.7 C2S-2J	Any applicable
		13956024	FRN 0020 C2S-2A	v91 and newer
Inteli	440- 480 VAC	613901	FRN 0011 C2S-4E	Any applicable
Logi/ Vended	440- 480 VAC	613901	FRN 0011 C2S-4E	Any applicable

PARTS BULLETIN



Continental Girbau • Girbau Industrial • Sports Laundry Systems
Onepress • Poseidon Textile Care • LG Commercial • Econo

Updating Software

What you will need

1. A computer whose operating system is Windows 10.
2. A computer that doesn't have firewalls that will limit the functionality of the GMP Tool.
3. Jump drive (included with the inverter).
4. USB A to B cable (Male to Male). This is a printer type cable that can be purchased online or in most big box stores.




5. Serial communication board part number 609164 (included on some machines).



The new inverter (part number 13956024) will include a jump drive with:

1. The new versions of firmware
2. The GMP Tool software that will have to get installed on your computer.
3. GMP Updating Firmware Instructions.
4. GMP Program Install for PC

 Always follow the warnings and procedures in the corresponding equipment instruction manual.